

EVOLUTION® Smart Connect® 2.56Firmware Update Instructions

To keep pace with new features and enhancmements being made to the EVOLUTION® controller, the EVOLUTION® Smart Connect owner must upgrade the firmware for his or her Smart Connect device. Enhancements include:

- **SMRT Logic**[™]: Enables communication with SMRT Logic internet gateway.
- Updates: Enables over-the-air firmware updates of EVOLUTION and Smart Connect.

Quick Directions:

- 1. Download the latest firmware update files from www.toro.com/evolution.
- 2. Copy and paste the files from the downloaded folder onto a formatted SD card.
- 3. Insert the card into the Smart Connect's SD card slot. The upgrade will begin automatically.

For a step-by-step walkthrough, please read on.



At the Computer



Prepare the SD card



Recommended:


- formatted FAT
- 2 GB max




Insert SD card into computer SD card slot. The SD card supplied with the EVO-WS can be used.



Download the firmware files



Browse to Toro's EVOLUTION page: USA & Canada: www.toro.com/en/evolution Int'l: www.toroevolution.com



Click on the Downloads link. (US website shown.)



Click the "Smart Connect" Firmware v2.56" link. Save the file to your computer's desktop.

C

Copy the files to the SD card



Navigate to downloaded folder titled "EVO-SC_Update_256" and open folder.



You will see two files. Sweep and COPY those files.



PASTE the files onto the SD card *at the root level*.




EJECT and remove the SD card.




At the Controller



The controller must be powered on. Open the EVOLUTION controller's front panel.




Controller does a soft reboot and is updated.

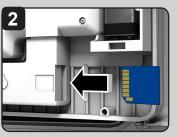


Insert SD card into the Smart Connect's SD card slot.



Go to ADVANCED-->FIRMWARE-->VERSION to confirm Smart Connect firmware is updated to 2.56.



The firmware update will begin and end automatically.

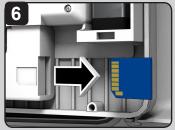

Remove SD card. See note below.



IMPORTANT NOTE ABOUT THE SD CARD:

After upgrading the EVOLUTION controller and Smart Connect, the firmware files must be removed from the SD card. If they are left on it, the controller will automatically initiate the upgrade procedure whenever the SD card is inserted into the Smart Connect.



Technical Support

USA & Canada: 1-877-345-8676 International: evolution@toro.com